H500Bx/H400Bx/H500Ex / H400Ex Series

THERMAL TRANSFER/ DIRECT THERMAL BARCODE PRINTER

USER'S MANUAL

Please keep user manual for reference



Copyright Information

©2016 Zhuhai Hengquan Barcode equipment Co., Ltd.

The copyright in this manual, the software and firmware in the printer described therein are owned by Zhuhai Hengquan Barcode equipment Co., Ltd. All rights reserved.

Information in this document is subject to change without notice and does not represent a commitment on the part of Zhuhai Hengquan Barcode equipment Co., Ltd. No part ofthis manual may be reproduced or transmitted in any form or by any means, for any purpose other than the purchaser's personal use, without the expressed written permission of Zhuhai Hengquan Barcode equipment Co., Ltd.



Contents

1. Introduction	1
1.1 Product Introduction 1	
1.2 Product Features	
1.2.1 Printer Standard Features	
1.2.2 Printer Optional Features	
1.3 General Specifications4	
1.4 Print Specifications	4
1.5 Ribbon Specifications	4
1.6 Media Specifications	5
2. Operations Overview	6
2.1 Unpacking and Inspection 6	
2.2 Printer Overview7	
2.2.1 Front View	
2.2.2 Interior View 8	
2.2.3 Rear View	
3. Setup 10	0
3.1 Setting up the Printer	
3.2 Loading the Ribbon11	
3.3 Loading the Media15	
3.3.1 Loading the Roll Labels	
3.3.2 Loading the Media in Peel-off mode (Option) 18	
3.3.3 Loading the Media in Cutter Mode (Option)	i
3.3.4 External Label Roll Mount Installation (Option)21	
4. LED and Button Functions	ļ
4.1 LED Indicator	
4.2 Regular Button Functions	
4.3 Power-on Utilities	
4.3.1 Ribbon and Gap/Black Mark Sensor Calibration	
4.3.2 Gap/Black Mark Calibration, Self-test and Dump Mode	,
4.3.3 Printer Initialization	
4.3.4 Set Black Mark Sensor as Media Sensor and Calibrate the Black Mark	
Sensor	
4.3.5 Set Gap Sensor as Media Sensor and Calibrate the Gap Sensor 29	
4.3.6 Skip AUTO.BAS	
F. Diagnostic Tool	1

5.1 Start the Diagnostic Tool	31
5.2 Printer Function	32
5.3 Calibrating Media Sensor by Diagnostic Tool	33
5.3.1 Auto Calibration	33
5.4 Setting Ethernet by Diagnostic Utility (Option)	34
5.4.1 Using USB interface to setup Ethernet interface	34
5.4.2 Using RS-232 interface to setup Ethernet interface	35
5.4.3 Using Ethernet interface to setup Ethernet interface	36
6. Troubleshooting	38
6.1 Common Problems	38
7. Maintenance	41
Revise History	42

1. Introduction

1.1 Product Introduction

Thank you very much for purchasing ZHUHAI HENGQUAN barcode printer.

The H500Bx series printer features two durable gear-driven motors that are capable of handling large capacity 300 meter ribbons and large rolls of media inside its sleek design. If the 5" interior label capacity is not enough, simply add an external media roll mount and the H500Bx can easily handle 8.4" OD rolls of labels designed for expensive industrial label printers.

The moveable sensor design can accept wide range of label media. All of the most frequently used barcode formats are included. Fonts and barcodes can be printed in any one of the four directions.

The simulation models are built in font of high quality and efficient (True Type font) and font engine. With flexible firmware design, user can also download the True Type Font from PC into printer memory forprinting labels. Besides the scalable font, it also provides a choice of five different sizes of alphanumeric bitmap font, OCR-A and OCR-B fonts. By integrating rich features, it is the most cost-effective and high performance printer in its class!

To print label formats, please refer to the instructions provided with your labeling software; if you need to write the custom programs, please refer to the XPL programming manual that can be found on the accessories CD-ROM or on ZHUHAI HENGQUAN website at http://www.xprinter.net

- Applications
 - Manufacturing & Warehousing
 - Work in Progress
 - Item Labels
 - Instruction labels
 - Agency labels
 - o Healthcare
 - Patient Identification
 - Pharmacy
 - Specimen Identification

- Parcel Post
 - Shipping/ Receiving Labels
- Small Office/ Home Office
- Retail Marking
 - Price tags
 - Shelf labels
 - Jewelry tags

1.2 Product Features

1.2.1 Printer Standard Features

The printer offers the following standard features.

Product standard	feature		203 dpi models	300 dpi models
Thermal transfer pr	inting		0	0
Direct thermal print	ing		0	0
ABS plastic enclosu	ıre			
Position adjustable	gap sensor			0
Position adjustable	black mark sens	or	0	0
Ribbon sensor		0		
Head open sensor			0	0
USB 2.0 (full speed	l) interface		0	0
8 MB SDRAM mem	nory		0	0
4 MB FLASH memo	ory		0	0
microSD memory c GB	ard reader for me	emory expansion up to 4	0	0
Real time clock				0
One power switch,				0
Standard industry e Eltron _® and Zebra _®	•	ut of the box including t	0	0
Internal 8 alpha-nui	•			
Fonts and barcodes directions (0, 90,18	•	n any one of the four	0	0
Embedded font			0	0
Downloadable fonts	s from PC to print	ter memory		0
Downloadable firm	ware upgrades	•		
Text, barcode, grap XPL programming i page)	hics/image printi		0	0
Supported bar code 1D bar code Code 39.	2D bar code PDF-417,	Supported image BITMAP,		
Code 39, Code 93, Code128UCC, Code128 subsets A,B,C, Codabar, Interleaved 2 of 5, EAN-8, EAN-13, EAN-128, UPC-A, UPC-E, EAN and UPC 2(5) digits add-on, MSI, PLESSEY, POSTNET, China POST, GS1 DataBar, Code 11	Maxicode, DataMatrix, QR code, Aztec, GS1 DataBar Composite code	BMP, PCX (Max. 256 colors graphics)		

1.2.2 Printer Optional Features

The printer offers the following optional features.

Product option feature	User options	Dealer options	Factory options
Internal Ethernet print server (10/100 Mbps) interface	-	-	0
Serial RS-232C (2400-115200 bps) interface	-	-	0
Centronics interface	-	-	\circ
Peel-off module	-	0	0
Guillotine cutter module (Full cut and partial cut) Paper thickness: 0.06~ 0.19mm, 500,000 cuts 0.20~ 0.25mm, 200,000 cuts	-	0	0
Note: Except for the linerless cutter, all regular/heavy duty/care label cutters DO NOT cut on media with glue.			
External roll mount with 3" core (8.4 OD) label spindle	0		
Extended plate for external roll mount	0		
Bluetooth module (RS-232C interface)	-	-	0

1.3 General Specifications

General Specifications				
Physical dimensions	300 mm (D) x 230 mm (W) x 194 mm (H)			
Weight	2.47 kg			
Electrical	External universal switching power supply			
	Input: AC 100-240V			
	Output: DC 24V 2.5A, 60W			
Environmental condition	Operation: 5 ~ 40°C (41 ~ 104°F), 25~85% non-condensing			
	Storage: -40 ~ 60 °C (-40 ~ 140° F), 10~90% non-condensing			

1.4 Print Specifications

Print Specifications	203 dpi models	300 dpi models		
Print head resolution	203 dots/inch (8 dots/mm) 300 dots/inch (12 dots/			
Printing method	Thermal transfer and direct thermal			
Dot size	0.125 x 0.125 mm			
(width x length)	(1 mm = 8 dots) (1 mm = 11.8 d			
Print speed	H500BX: 2, 3, 4, 5 ips	H500E: 1.5, 2, 3, 4 ips		
(inches per second)	H400B: 2, 3, 4, 5 ips	H400E: 1.5, 2, 3, 4 ips		
Print speed for peel	0.4			
mode & cutter mode	2, 3 ips			
Max. print width	108 mm (4.25") 104 mm (4.09			
Max. print length	2,794 mm (110") 1,016 mm (40")			

1.5 Ribbon Specifications

Ribbon Specifications				
Ribbon outside diameter	Max. 67 mm			
Ribbon length	300 meter			
Ribbon core inside diameter	1 inch (25.4 mm)			
Ribbon width	Max. 110 mm			
	Min. 40 mm			
Ribbon wound type	Outside wound			

1.6 Media Specifications

Media Specifications	203 dpi models 300 dpi models				
Label roll capacity	127 mm (5") OD				
Media type	Continuous, die-cut, black mark, fan-fold, notch				
Media wound type	Printing face outside wound &	Printing face inside wound			
Media width (label +	Max. 118 mm (4.6")				
liner)	Min. 25.4 mm (1.0")				
Media thickness (label	Max. 0.254 mm (10 mil)				
+ liner)	Min. 0.06 mm (2.36 mil)				
Media core diameter	25.4 mm~38 mm (1"~1.5")				
Label length	10~2,794 mm (0.39"~110")	10~1,016 mm (0.39"~40")			
	Note:				
	If your label length is less than 25.4mm (1"), we				
	recommend you to use the perforation at the ga				
	easier tear away.				
Label length (peeler	Max. 152.4 mm (6")				
mode)	Min. 25.4 mm (1")				
Label length (cutter	Max. 2,794 mm (110")	Max. 1,016 mm (40")			
mode)	Min. 25.4 mm (1")	Min. 25.4 mm (1")			
Gap height	Min. 2 mm (0.09")				
Black mark height	Min. 2 mm (0.09")				
Black mark width	Min. 8 mm (0.31")				


2. Operations Overview

2.1 Unpacking and Inspection

This printer has been specially packaged to withstand damage during shipping. Please carefully inspect the packaging and printer upon receiving the barcode printer. Please retain the packaging materials in case you need to reship the printer.

Unpacking the printer, the following items are included in the carton.

- One printer unit
- One Windows labeling software/Windows driver CD disk
- One quick installation guide
- One power cord
- One auto switching power supply
- One USB interface cable
- Two ribbon spindle
- One ribbon paper core
- One label spindle

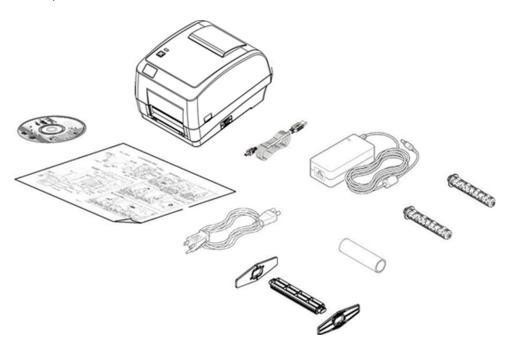

If any parts are missing, please contact the Customer Service Department of your purchased reseller or distributor.


2.2 Printer Overview

2.2.1 Front View




- 1. LED indicator
- 2. Feed key
- 3. Paper exit chute
- 4. Power switch
- 5. Top cover open tab

2.2.2 Interior View

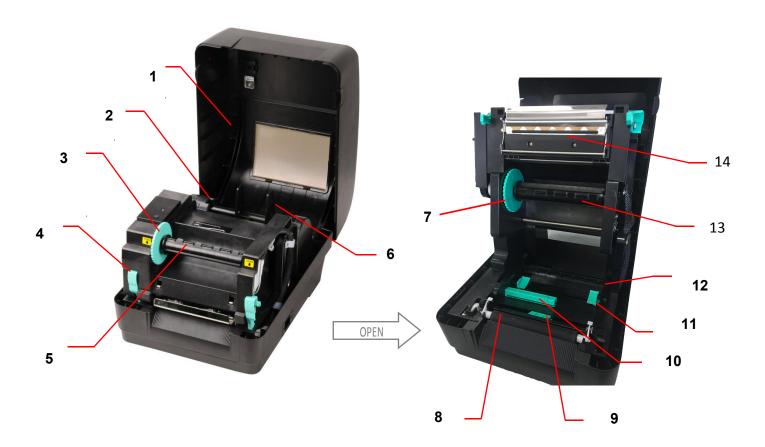

- 1. Printer top cover
- 2. Media supply spindle
- 3. Ribbon rewind hub
- 4. Print head release button
- 5. Ribbon rewind spindle
- 6. Fixing tab
- 7. Ribbon supply hub
- 8. Platen roller
- 9. Black mark sensor
- 10. Gap sensor
- 11. Media guide
- 12. Media bar
- 13. Ribbon supply spindle
- 14. Print head

2.2.3 Rear View

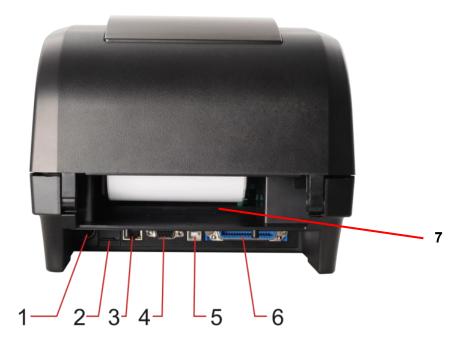

- 1. Power jack socket
- 2. *microSD card slot
- 3. Internal Ethernet interface (Option)
- 4. RS-232C interface (Option)
- 5. USB interface (USB 2.0/ Full speed mode)
- 6. Centronics interface (Option)
- 7. Rear external label entrance chute


Note:

The interface picture here is for reference only. Please refer to the product specification for the interfaces availability.

3. Setup

3.1 Setting up the Printer

- 1. Place the printer on a flat, secure surface.
- 2. Make sure the power switch is off.
- Connect the printer to the computer with the provided USB cable.
- 4. Plug the power cord into the AC power cord socket at the rear of the printer, and then plug the power cord into a properly grounded power outlet.

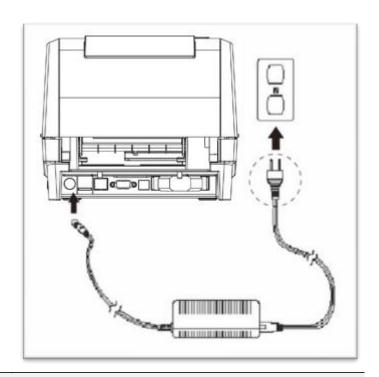

Note:

- * Please switch OFF printer power switch prior to plug in the power cord to printer power jack.
- * The interface picture here is for reference only. Please refer to the product specification for the interfaces availability.


3.2 Loading the Ribbon



 Open the printer top cover by pressing the top cover open tabs located on each side of the printer.



2. Insert the paper core to the ribbon rewind spindle.

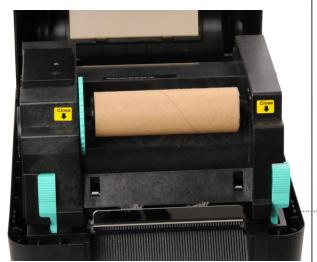

3. Insert the left side of ribbon rewind spindle to the ribbon rewind hub first then insert the right side of ribbon rewind spindle to the hole at the right side of ribbon mechanism.





4. Push the print head release button to open the print head mechanism.






5. Insert the ribbon to the ribbon spindle.



6. Insert the left side of ribbon supply spindle to the ribbon supply hub first then insert the right side of ribbon supply spindle to the hole at the right side of ribbon mechanism.



7. Pull the leader of the ribbon through the print head and stick the leader of the ribbon onto the ribbon rewind paper core.

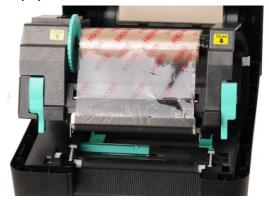

8. Turn the ribbon rewind hub until the ribbon plastic leader is thoroughly wound and the black section of the ribbon covers the print head.




Close the print head mechanism by both hands and make sure the latches are engaged securely.





Ribbon loading path

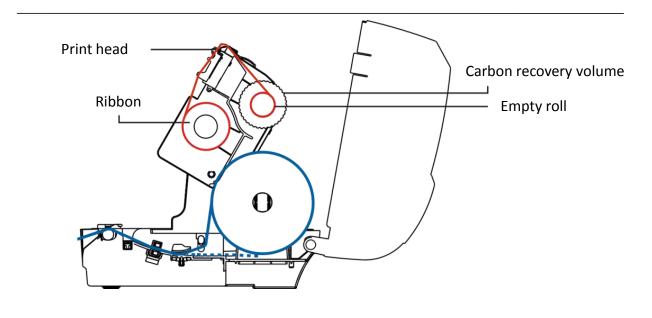

3.3 Loading the Media

3.3.1 Loading the Roll Labels




 Open the printer top cover by pressing the top cover open tabs located on each side of the printer.



2. Insert the paper roll into the media supply spindle and use two fixing tabs to fix the paper roll onto the center of the spindle. (If your paper width is 4 inch, you can remove the fixing tabs from the supply spindle.)



3. Place the paper roll onto the paper roll mount.

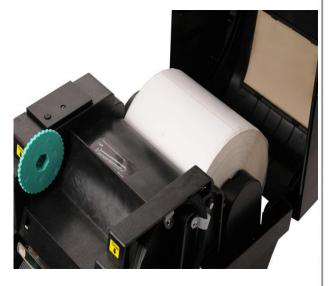






4. Push the print head release button to open the print head mechanism.




Gap sensor

Media guide

 Feed the paper, printing side face up, through the media bar, media sensor and place the label leading edge onto the platen roller. Move the media guides to fit the label width.

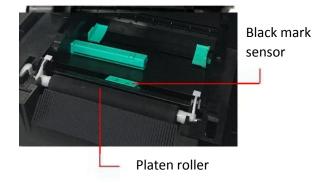


Note: The media sensor position is moveable. Please make sure the gap or black mark is at the location where media gap/black mark will pass through forsensing.

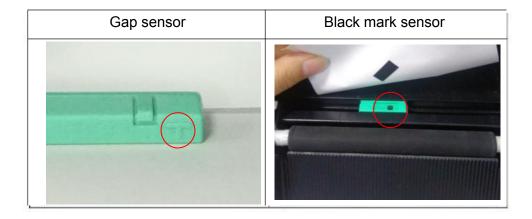





6. Close the print head mechanism by both hands and make sure the latches are engaged securely.

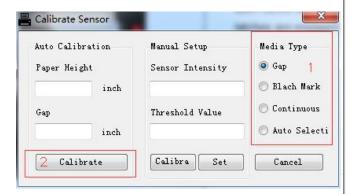

Use "Diagnostic Tool" to set the media sensor type and calibrate the selected sensor. (Start the "Diagnostic tool" → Select the "Printer Configuration" tab → Click the "Calibrate Sensor" button)
 Please refer to section 5.3.

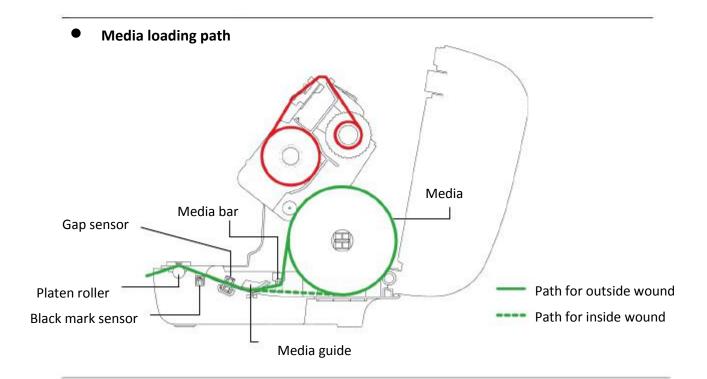

3.3.2 Loading the Media in Peel-off mode (Option)

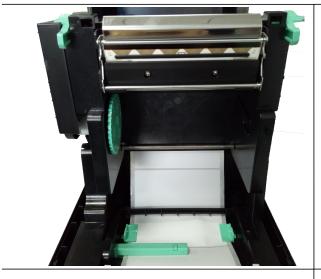


 Refer to chapter 3.3.1 to install the label. Use "Diagnostic Tool" to set the media sensor type and calibrate the selected sensor.



2. Pull the label through the front of the printer and take some labels off only leave the liner.

Liner Label

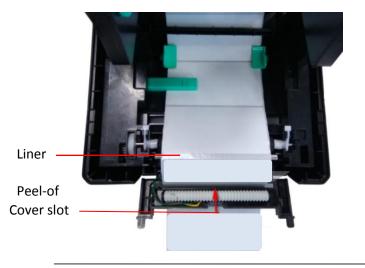


3. Open the peel-off cover. Feed the liner into peel-off cover slot.



 Close the peel-off module. Use the DiagTool to set the peel-off mode by selecting "PEEL" option for Post-Print Action setting then click "Set" button to enable the peel-off mode.



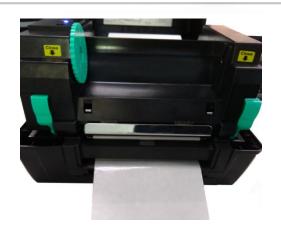

5. Close the print head mechanism and printer cover. Printer is ready for peel-off mode.



6. Press the FEED button to test.

Label — Liner

Note:

 $\label{lem:please calibrate the gap/black mark sensor when changing media. \\$

3.3.3 Loading the Media in Cutter Mode (Option)




1. Refer to chapter 3.3.1 to install the label.



2. Lead the media through the cutter paper opening.




 Close the print head mechanism and printer cover. Use the DiagTool to set the printer for cutter mode by selecting "CUTTER" option for Post-Print Action setting then click "Set" button to enable the cutter mode. Press the FEED button to test.



Note:


Please calibrate the gap/black mark sensor when changing media.

3.3.4 External Label Roll Mount Installation (Option)

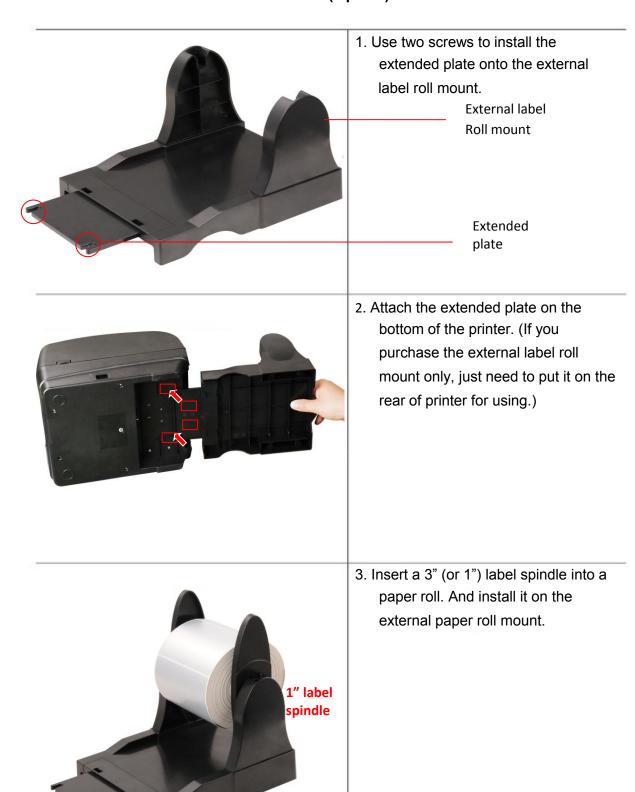



4. Feed the media through the rear external label entrance chute.

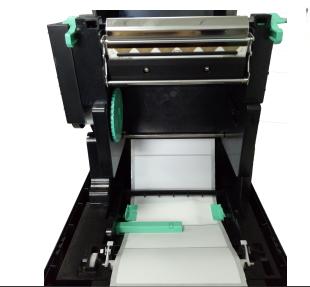

5. Refer to chapter 3.3.1 to install the label. Use "Diagnostic Tool" to set the media sensor type and calibrate the selected sensor.

Note:

Please calibrate the gap/black mark sensor when changing media.

4. LED and Button Functions

This printer has one button and one three-color LED indicator. By indicating the LED with different color and pressing the button, printer can feed labels, pause the printing job, select and calibrate the media sensor, print printer self-test report, reset printer to defaults (initialization). Please refer to the button operation below for different functions.

4.1 LED Indicator

LED Color	Description
Blue/ Solid	This illuminates that the power is on and the device is ready to
	use.
Blue / Flash	This illuminates that the system is downloading data from PC to
	memory or the printer is paused.
Purple	This illuminates that the system is clearing data from printer.
Red / Solid	This illuminates printer head open, cutter error.
Red / Flash	This illuminates a printing error, such as head open, paper
	empty, paper jam, ribbon empty, or memory error etc.

4.2 Regular Button Functions

1. Feed labels

When the printer is at ready states (Blue/ Solid), press the button to feed one label to the beginning of next.

2. Pause the printing job

When the printer is at printing states, press the button to pause a print job. When the printer is paused the LED will be blue blinking. Press the button again to continue the printing job.

4.3 Power-on Utilities

There are six power-on utilities to set up and test printer hardware. These utilities are activated by pressing FEED button then turning on the printer power simultaneously and release the button at different color of LED.

Please follow the steps below for different power-on utilities.

- 1. Turn off the printer power switch.
- 2. Hold on the button then turn on the power switch.
- 3. Release the button when LED indicates with different color for different functions.

Power on utilities	The LE	D color wi	II be chan	ged as fo	llowing patter	n:	
LED color	Purple	Red	Purple	Bule	Bule/Purple	Red/Purple	Solid bule
Functions		(5 blinks)	(5 blinks)	(5 blinks)	(5 blinks)	(5 blinks)	
1. Ribbon sensor calibration and gap /		Release					
black mark sensor calibration							
2. Gap / black mark sensor calibration,			Release				
Self-test and enter dump mode							
3. Printer initialization				Release			
4. Set black mark sensor as media					Release		
sensor and calibrate the black mark							
sensor							
5. Set gap sensor as media sensor and						Release	
calibrate the gap sensor							
6. Skip AUTO.BAS							Release

4.3.1 Ribbon and Gap/Black Mark Sensor Calibration

Gap/black mark sensor sensitivity should be calibrated at the following conditions:

- 1. A brand new printer
- 2. Change label stock
- 3. Printer initialization

Please follow the steps below to calibrate the ribbon and gap/black mark sensor.

- 1. Turn off the power switch.
- 2. Hold on the button then turn on the power switch.
- 3. Release the button when LED becomes red and blinking. (Any red will do during the 5 blinks).
- It will calibrate the ribbon sensor and gap/black mark sensor sensitivity.

The LED color will be changed as following order:
Purple → red (5 blinks) → purple (5 blinks) → blue (5 blinks) → blue/purple (5 blinks)
→ red/purple (5 blinks) → solid blue

Note:

Please select gap or black mark sensor by sending GAP or BLINE command to printer prior to calibrate the sensor.

For more information about GAP and BLINE command, please refer to XPL programming manual.

4.3.2 Gap/Black Mark Calibration, Self-test and Dump Mode

While calibrate the gap/black mark sensor, printer will measure the label length, print the internal configuration (self-test) on label and then enter the dump mode. To calibrate gap or black mark sensor, depends on the sensor setting in the last print job.

Please follow the steps below to calibrate the sensor.

- 1. Turn off the power switch.
- 2. Hold on the button then turn on the power switch.
- Release the button when LED becomes purple and blinking. (Any purple will do during the 5 blinks)
- The LED color will be changed as following order.
 Purple → red (5 blinks) → purple (5 blinks) → blue (5 blinks) → blue/purple (5 blinks)
 → red/purple (5 blinks) → solid blue
- 4. It calibrates the sensor and measures the label length and prints internal settings then enter the dump mode.

Note:


Please select gap or black mark sensor by Diagnostic Tool or by GAP or BLINE command prior to calibrate the sensor.

For more information about GAP and BLINE command, please refer to XPL programming manual.

■ Self-test

Printer will print the printer configuration after gap/black mark sensor calibration. Self-test printout can be used to check if there is any dot damage on the heater element, printer configurations and available memory space.

Self-test printout

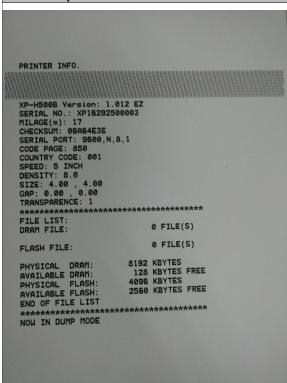

Printer model name & Main board firmware version

Printer serial number

Printed mileage

Main board firmware checksum

Serial port setting

Code page

Country code

Print speed

Print darkness

Label size (width, height)

Black mark or gap size (vertical gap, offset)

Sensor sensitivity

File management information

CODE PAGE: 850

COUNTRY CODE: 001

SPEED: 5 INCH

DENSITY: 8.0

SIZE: 4.00 , 4.00

GAP: 0.00 , 0.00

TRANSPARENCE: 1

Print speed (inch/sec)
Print darkness
Label size (inch)
Gap distance (inch)
Gap/black mark sensor intension
Code page
Country code

SERIAL PORT: 9600, N, 8, 1

RS232 serial port configuration

FLASH FILE: 0 FILE(S)

PHYSICAL DRAM: 8192 KBYTES
AVAILABLE DRAM: 128 KBYTES FREI
PHYSICAL FLASH: 4096 KBYTES


AVAILABLE FLASH: 2560 KBYTES FRE

END OF FILE LIST

Numbers of download files Total & available memory space

■ Dump mode

Printer will enter dump mode after printing printer configuration. In the dump mode, all characters will be printed in 2 columns as following. The left side characters are received from your system and right side data are the corresponding hexadecimal value of the characters. It allows users or engineers to verify and debug the program.

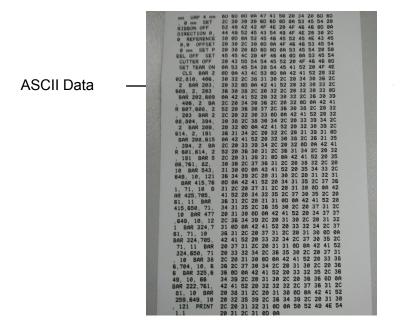

Hex decimal data related to left column of ASCII data

Note:

- 1. Dump mode requires 4" wide paper width.
- 2. Turn off / on the power to resume printer for normal printing.

4.3.3 Printer Initialization

Printer initialization is used to clear DRAM and restore printer settings to defaults. The only one exception is ribbon sensitivity, which will note be restored to default.

Printer initialization is activated by the following procedures.

- 1. Turn off the power switch.
- 2. Hold on the button then turn on the power switch.
- 3. Release the button when LED turns blue after 5 purple blinks. (Any blue will do during the 5 blinks).
- The LED color will be changed as following:
 Purple → red (5 blinks) → purple (5 blinks) → blue (5 blinks) → blue/purple (5 blinks)
 → red/purple (5 blinks) → solid blue

Printer configuration will be restored to defaults as below after initialization.

Parameter	Default setting	
Speed	101.6(127) mm/sec (4 or 5 ips) (203DPI)	
	76(101.6) mm/sec (3 or 4 ips) (300DPI)	
Density	8	
Label Width	4" (101.5 mm)	
Label Height	4" (101.5 mm)	
Sensor Type	Gap sensor	
Gap Setting	0.12" (3.0 mm)	
Print Direction	0	
Reference Point	0,0 (upper left corner)	
Offset	0	
Tear Mode	On	
Peel off Mode	Off	
Cutter Mode	Off	
Serial Port Settings	9600 bps, none parity, 8 data bits, 1 stop bit	
Code Page	850	
Country Code	001	
Clear Flash Memory	No	
IP Address	DHCP	

4.3.4 Set Black Mark Sensor as Media Sensor and Calibrate the Black Mark Sensor

Please follow the steps as below.

- 1. Turn off the power switch.
- 2. Hold on the button then turn on the power switch.
- 3. Release the button when LED turns blue/purple after 5 blue blinks. (Any blue/purple will do during the 5 blinks).
- The LED color will be changed as following:
 Purple → red (5 blinks) → purple (5 blinks) → blue (5 blinks) → blue/purple (5 blinks)
 → red/purple (5 blinks) → solid blue

4.3.5 Set Gap Sensor as Media Sensor and Calibrate the Gap Sensor

Please follow the steps as below.

- 1. Turn off the power switch.
- 2. Hold on the button then turn on the power switch.

- 3. Release the button when LED turns red/purple after 5 blue/purple blinks. (Any red/purple will do during the 5 blinks).
- The LED color will be changed as following:
 Purple → red (5 blinks) → purple (5 blinks) → blue (5 blinks) → blue/purple (5 blinks) → red/purple (5 blinks) → solid blue

4.3.6 Skip AUTO.BAS

XPL programming language allows user to download an auto execution file to flash memory. Printer will run the AUTO.BAS program immediately when turning on printer power. The AUTO.BAS program can be interrupted without running the program by the power-on utility.

Please follow the procedures below to skip an AUTO.BAS program.

- 1. Turn off printer power.
- 2. Press the FEED button and then turn on power.
- 3. Release the FEED button when LED becomes solid blue.
- The LED color will be changed as following:
 Purple → red (5 blinks) → purple (5 blinks) → blue (5 blinks) → blue/purple (5 blinks) → red/purple (5 blinks) → solid blue
- 4. Printer will be interrupted to run the AUTO.BAS program.

5. Diagnostic Tool

ZHUHAI HENGQUAN's Diagnostic Utility is an integrated tool incorporating features that enable you to explore

a printer's settings/status; change a printer's settings; download graphics, fonts and firmware; create a printer bitmap font; and send additional commands to a printer. With the aid of this powerful tool, you can review printer status and settings in an instant, which makes it much easier to troubleshoot problems and other issues.


5.1 Start the Diagnostic Tool

- 1. Double click on the Diagnostic tool icon Piagnostic Tool.exe to start the software.
- 2. There are four features (Printer Configuration, File Manager, Bitmap Font Manager, Command Tool) included in the Diagnostic utility.



5.2 Printer Function

1. Select the PC interface connected with barcode printer.

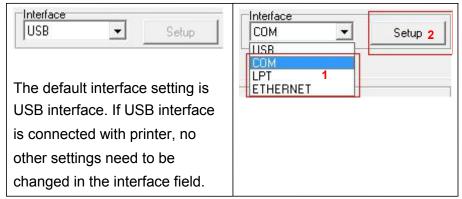

- 2. Click the "Printer Function" button to setup.
- 3. The detail functions in the Printer Function Group are listed as below.


Printer Function	Function	Description
Calibrate Sensor Ethernet Setup	Calibrate Sensor	Calibrate the sensor specified in the Printer Setup group media sensor field
RTC Setup	Ethernet Setup	Setup the IP address, subnet mask, gateway for the on board Ethernet
Factory Default	RTC Setup	Synchronize printer Real Time Clock with PC
Reset Printer	Print Test Page	Print a test page
Print TestPage	Reset Printer	Reboot printer
Configuration Page	Factory Default	Initialize the printer and restore the settings to factory default. (Please refer section 4.3.3)
Dump Text	Dump Text	To activate the printer dump mode.
Ignore AUTO.BAS	Ignore AUTO.BAS	Ignore the downloaded AUTO.BAS program
Password Setup	Configuration Page	Print printer configuration (Please refer section 4.3.2)
Exit Line Setup	Password Setup	Set the password to protect the settings

5.3 Calibrating Media Sensor by Diagnostic Tool


5.3.1 Auto Calibration

1. Make sure the media is install ready and print head mechanism is closed. (Please refer to section 3.3.)


Note: The media sensor position is moveable. Please make sure the gap () or black mark is at the location where media gap/black mark will pass through for Sensing.

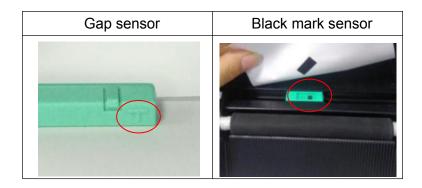

- 2. Turn on the printer power switch.
- 3. Open Diagnostic tool and set interface. (The default setting is USB.)

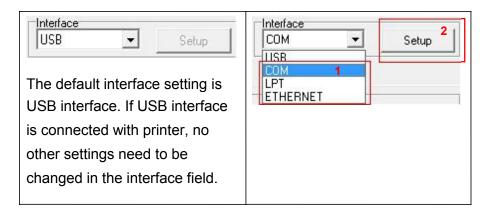

- 4. Click the "Calibrate Sensor" button.
- 5. Select the media type and click the "Calibrate" button.

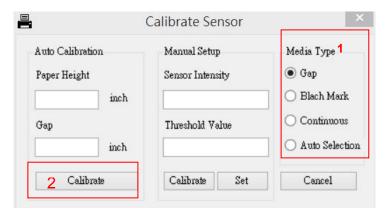

5.4 Setting Ethernet by Diagnostic Utility (Option)


The Diagnostic Utility is enclosed in the CD disk \Utilities directory. Users can use Diagnostic Tool to setup the Ethernet by RS-232, USB and Ethernet interfaces. The following contents will instruct users how to configure the Ethernet by these three interfaces.

5.4.1 Using USB interface to setup Ethernet interface

- 1. Connect the USB cable between the computer and the printer.
- 2. Turn on the printer power.
- 3. Start the Diagnostic Utility by double clicking on the [■] Diagnostic Tool.exe icon.
- 4. The Diagnostic Utility default interface setting is USB interface. If USB interface is connected with printer, no other settings need to be changed in the interface field.





5. Click on the "Ethernet Setup" button from "Printer Function" group in Printer Configuration tab to setup the IP address, subnet mask and gateway for the on board Ethernet.

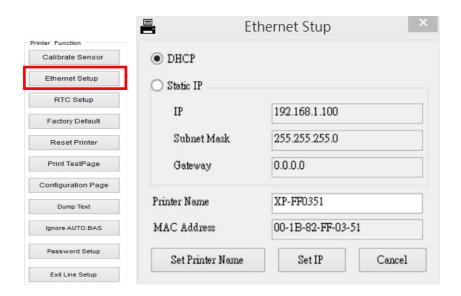


5.4.2 Using RS-232 interface to setup Ethernet interface

- 1. Connect the computer and the printer with a RS-232 cable.
- 2. Turn on the printer power.
- 3. Start the Diagnostic Utility by double clicks on the Diagnostic Tool.exe icon.
- 4. Select "COM" as interface then click on the "Setup" button to setup the serial port baud rate, parity check, data bits, stop bit and flow control parameters.

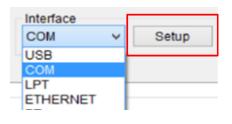

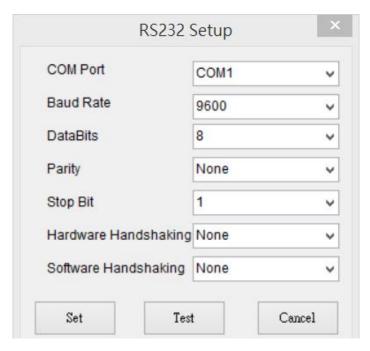


5. Click on the "Ethernet Setup" button from printer function of Printer Configuration tab to setup the IP address, subnet mask and the gateway for the on board Ethernet.

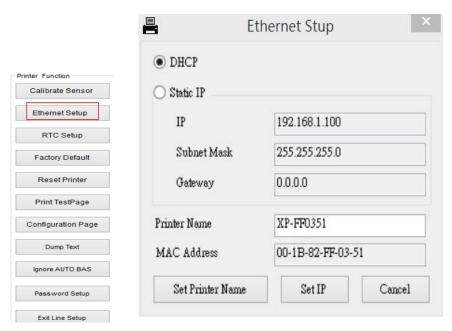


5.4.3 Using Ethernet interface to setup Ethernet interface

- 1. Connect the computer and the printer to the LAN.
- 2. Turn on the printer power.
- 3. Start the Diagnostic Utility by double clicks on the Diagnostic Tool.exe icon.
- 4. Select "Ethernet" as the interface then click on the "Setup" button to setup the IP address, subnet mask and gateway for the on board Ethernet.

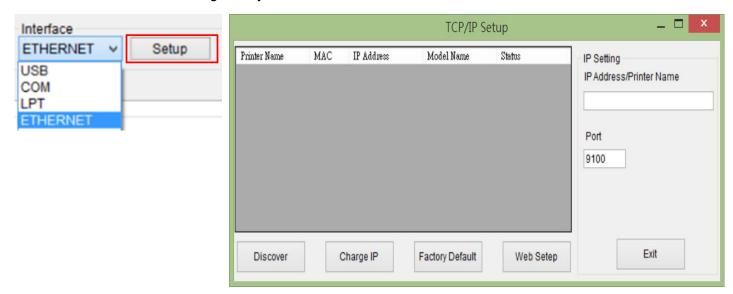

- 5. Click the "Discover Device" button to explore the printers that exist on the network.
- 6. Select the printer in the left side of listed printers, the correspondent IP address will be shown in the right side "IP address/Printer Name" field.
- 7. Click "Change IP Address" to configure the IP address obtained by DHCP or static.

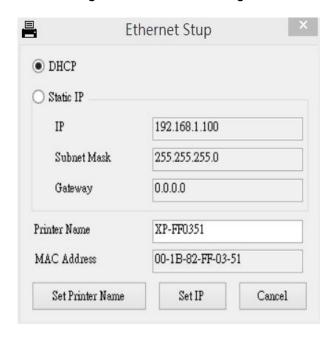

The default IP address is obtained by DHCP. To change the setting to static IP address, click "Static IP" radio button then enter the IP address, subnet mask and gateway. Click "Set IP" to take effect the settings.

Users can also change the "Printer Name" by another model name in this fields then click "Set Printer Name" to take effect this change.

Note: After clicking the "Set Printer Name" or "Set IP" button, printer will reset to take effect the settings.

8. Click "Exit" button to exit the Ethernet interface setup and go back to Diagnostic Tool main screen.

Factory Default button

This function will reset the IP, subnet mask, gateway parameters obtained by DHCP and reset the printer name.

Web setup button

Except to use the Diagnostic Utility to setup the printer, you can also explore and configure the printer settings and status or update the firmware with the IE or Firefox web browser. This feature provides a user friendly setup interface and the capability to manage the printer remotely over a network.

6. Troubleshooting

6.1 Common Problems

The following guide lists the most common problems that may be encountered when operating this barcode printer. If the printer still does not function after all suggested solutions have been invoked, please contact the Customer Service Department of your purchased reseller or distributor for assistance.

Problem	Possible Cause	Recovery Procedure
Power indicator does not illuminate	* The power cord is not properly connected.	* Plug the power cord in printer and outlet. * Switch the printer on.
- The printer status from DiagTool shows "Head Open".	* The printer carriage is open.	* Please close the print carriage.
- The printer status from DiagTool shows "Ribbon End Err." Or "Ribbon Encoder Err."	* Running out of ribbon. * The ribbon is installed incorrectly.	* Supply a new ribbon roll. * Please refer to the steps on section 3.2 to re-install the ribbon.
The printer status from DiagTool shows "Out of Paper".	* Running out of label. * The label is installed incorrectly. * Gap/black mark sensor is not calibrated.	* Supply a new label roll. * Please refer to the steps on section 3.3 to reinstall the label roll. * Calibrate the gap/black mark sensor.
- The printer status from DiagTool shows "Paper Jam".	* Gap/black mark sensor is not set properly. * Make sure label size is set properly. * Labels may be stuck inside the printer mechanism.	* Calibrate the gap/black mark sensor. * Set label size correctly.
- "Take Label".	* Peel-off function is enabled.	* If the peel-off module is installed, please remove the label. * If there is no peel-off module in front of the printer, please switch off the printer and install it. * Check if the connector is plugging correctly.

Not Printing	* Cable is not well connected to serial or USB interface or parallel port. * The serial port cable pin configuration is not pin to pin connected.	* Re-connect cable to interface. * If using serial cable, - Please replace the cable with pin to pin connected Check the baud rate setting. The default baud rate setting of printer is 9600,n,8,1. * If using the Ethernet cable, - Check if the Ethernet RJ-45 connector bule LED is lit on Check if the Ethernet RJ-45 connector amber LED is blinking Check if the printer gets the IP address when using DHCP mode Check if the IP address is correct when using the static IP address Wait a few seconds let the printer get the communication with the server then check the IP address setting again. * Chang a new cable. * Ribbon and media are not compatible. * Verify the ribbon-inked side. * Reload the ribbon again. * Clean the print head. * The print density setting is incorrect. * Print head's harness connector is not well connected with printheat. Turn off the printer and plug the connector again. * Check your program if there is a command PRINT at the end of the file and there must have CRLF at the end of each command line.	
Memory full	* The space of FLASH/DRAM	* Delete unused files in the FLASH/DRAM. * The max. numbers of DRAM is 256 files. * The max. user addressable memory space of DRAM is 256KB.	
(FLASH / DRAM)	is full.	* The max. numbers of file of FLASH is 256 files. * The max. user addressable memory space of FLASH is 2560KB.	
	* microSD card is damaged.	* Use the supported capacity microSD card.	
microSD card is unable to	* microSD card doesn't insert	* Insert the microSD card again.	
microso card is dilable to		* The supported microSD card spec and the	
use	correctly. * Use the non-approved		
	microSD card manufacturer.	approved microSD card manufacturers,	
		please refer to section 2.2.3.	
	* Ribbon and media is loaded	* Reload the supply.	
	incorrectly * Dust or adhesive	* Clean the print head.	
	accumulation on the print	* Clean the platen roller. * Adjust the print density and print speed.	
	head.	* Run printer self-test and check the print	
Poor Print Quality	* Print density is not set	head test pattern if there is dot missing in	
	properly.	the pattern.	
	* Printhead element is	* Change proper ribbon or proper label	
	damaged.	media.	
	* Ribbon and media are	* The print head mechanism does not latch	
	incompatible.	the print head properly.	
	* The printhead pressure is not		
	set properly.		
		* Plug in the connect cable correctly.	
	* The connector is loose.	* Remove the label.	
Cutter is not working	* Cutter jam.	* Make sure the thickness of label is less	
	* Cutter PCB is damaged.	than 0.19 mm.	
	Janes . 22 io damagod.	* Replace a cutter driver IC board.	
	1	1 topiado a dattor arreor lo board.	

Skip labels when printing	Label size is not specified properly. Sensor sensitivity is not set properly. The media sensor is covered with dust.	* Check if label size is setup correctly. * Calibrate the sensor by Auto Gap or Manual Gap options. * Clear the GAP/Black mark sensor by blower.	
The printing position of small label is incorrect	* Media sensor sensitivity is not set properly. * Label size is incorrect. * The parameter Shift Y in the * The vertical offset setting in the driver is incorrect.	* Calibrate the sensor sensitivity again. * Set the correct label size and gap size. * If using the software BarTender, please set the vertical offset in the driver. Page Setup Graphics Stock Options About Media Settings Method: Direct Thermal Type: Use Current Printer Setting Post-Print Action: Tear Off Ogcurrence: After Every Page Interval: Feed Offset: 0.0 mm Position Adjustments Use Current Printer Settings Yertical Offset: OK Cancel Apply Help	
Missing printing on the left or right side of label	* Wrong label size setup.	* Set the correct label size.	
RTC time is incorrect when reboot the printer	* The battery has run down.	* Check if there is a battery on the main board.	
Wrinkle problem	* Ribbon installation is incorrect. * Media installation is incorrect. * Print density is incorrect. * Media feeding is incorrect.	* Please set the suitable density to have good print quality. * Make sure the label guide touch the edge of the media guide.	
Gray line on the blank label	* The print head is dirty. * The platen roller is dirty.	* Clean the print head. * Clean the platen roller.	
Irregular printing	* The printer is in Hex Dump mode. * The RS-232 setting is incorrect.	* Turn off and on the printer to skip the dump mode. * Re-set the Rs-232 setting.	

7. Maintenance

This session presents the clean tools and methods to maintain your printer.

- 1. Please use one of following material to clean the printer.
- Cotton swab
- Lint-free cloth
- Vacuum / Blower brush
- Medical alcohol
- 2. The cleaning process is described as following,

Printer Part	Method	Interval
		Clean the print head when changing a new label roll
Print Head	Head Cleaner Pan	
Platen Roller	Turn the power off. Rotate the platen roller and wipe it thoroughly with Medical alcohol and a cotton swab, or lint-free cloth.	Clean the platen roller when changing a new label roll
Tear Bar/Peel Bar	Use the lint-free cloth with Medical alcohol to wipe it.	As needed
Sensor	Compressed air or vacuum	Monthly
Exterior	Wipe it with water-dampened cloth	As needed
Interior	Brush or vacuum	As needed

Note:

- Do not touch printer head by hand. If you touch it careless, please use ethanol to clean it.
- Please use medical alcohol. Do not use industrial alcohol, industrial alcohol may damage the print head
- Regularly clean the print head and supply sensors once change a new ribbon to keep printer performance and extend printer life.

Update record

Date	Content	Editor
2017/03/26	Release V1.00	Austin Bill



Corporate Headquarters

4th Floor, 2 Building, No. 639 Huayu Road, Qianshan Industrial Park, Xiangzhou District, Zhuhai City, Guangdong Province, China. TEL: +86-4006-139-828

Website: www.xprinter.net Zhuhai Hengquan Barcode equipment Co., Ltd.